




WORKING AT HEIGHT
高空工作

2

WORKING PLATFORM NOT CLOSELY
BOARDED
工作台之地台沒有被密封

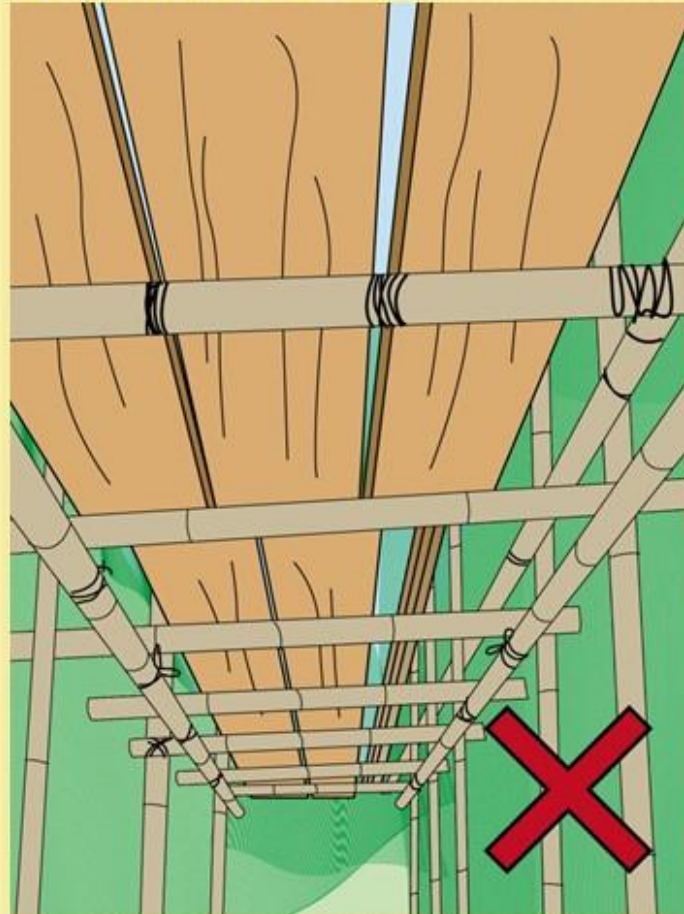


NO FALL ARRESTING MEASURE WHEN
DISMANTLING SCAFFOLD
拆卸棚架時沒有任何防墮措施



FULL-HEIGHT GATE OF LIFT SHAFT OPENING

NOT LOCKED

升降機井口全高閘門未鎖上

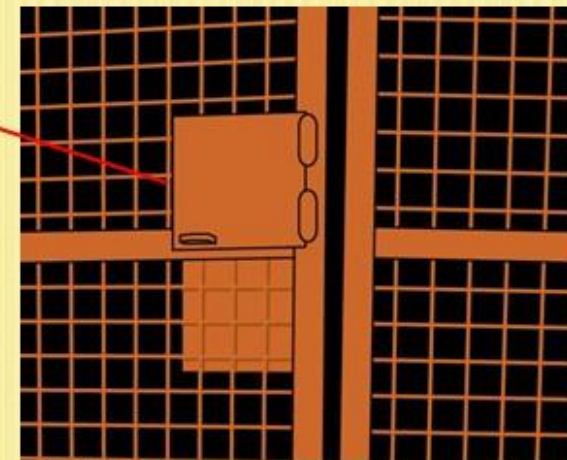


NO GUARD-RAILS WERE INSTALLED

沒有圍欄

NO FALL ARRESTING MEASURE WAS IN USE

沒有使用防墮措施

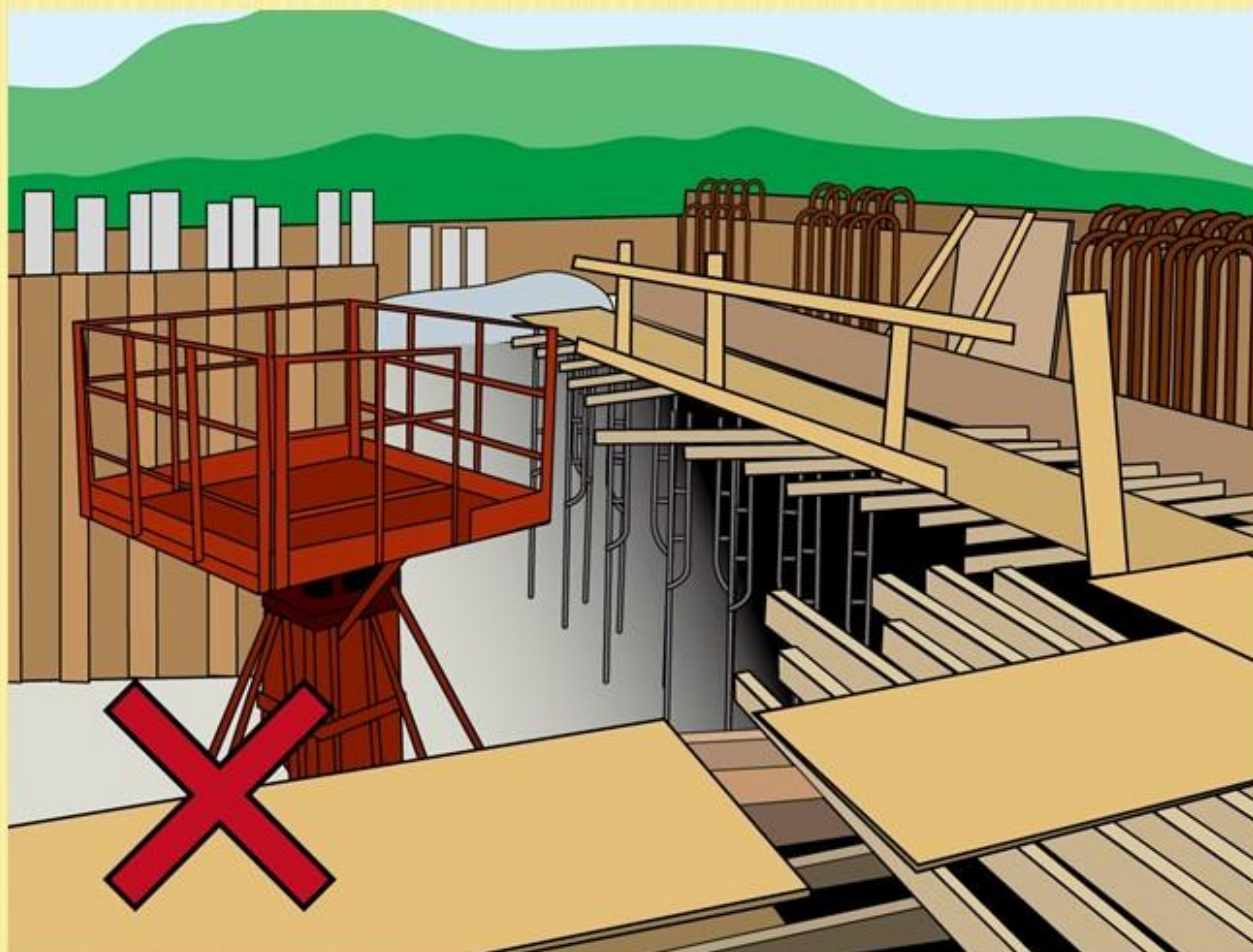


使用時，未有安裝圍欄

NO GUARD RAILS INSTALLED DURING OPERATION

不正確使用流動升降台

UNSAFE USE OF MOBILE ELEVATED WORKING PLATFORM

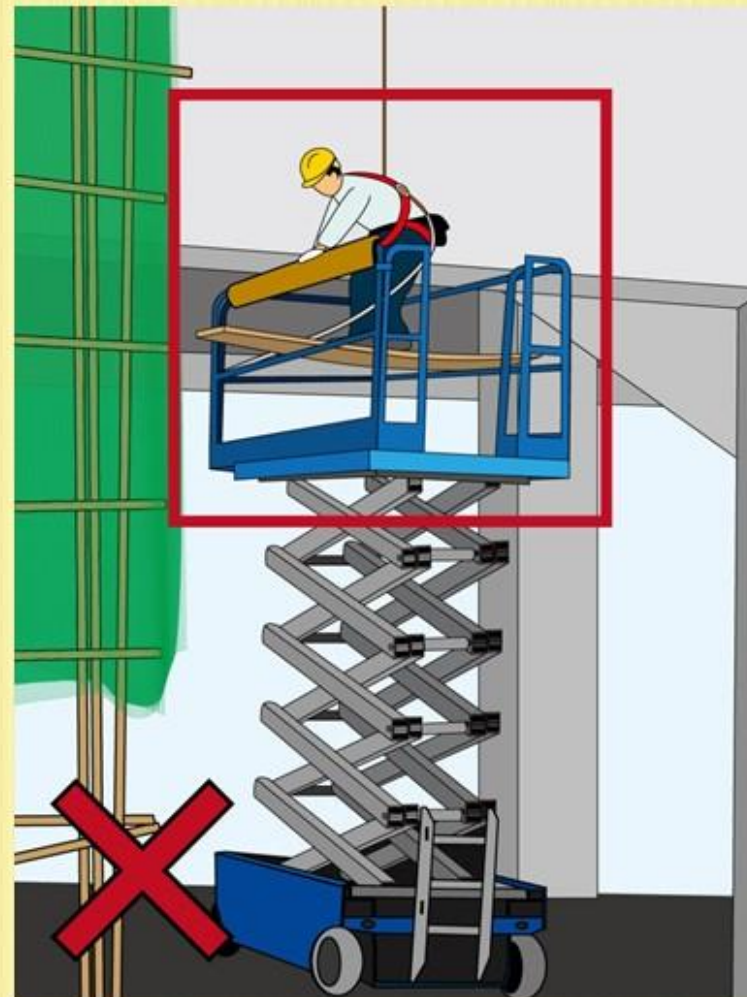


不合乎標準的木梯

SUBSTANDARD WOODEN LADDER




升降機門未有上鎖

LIFT METAL GATE UNLOCKED

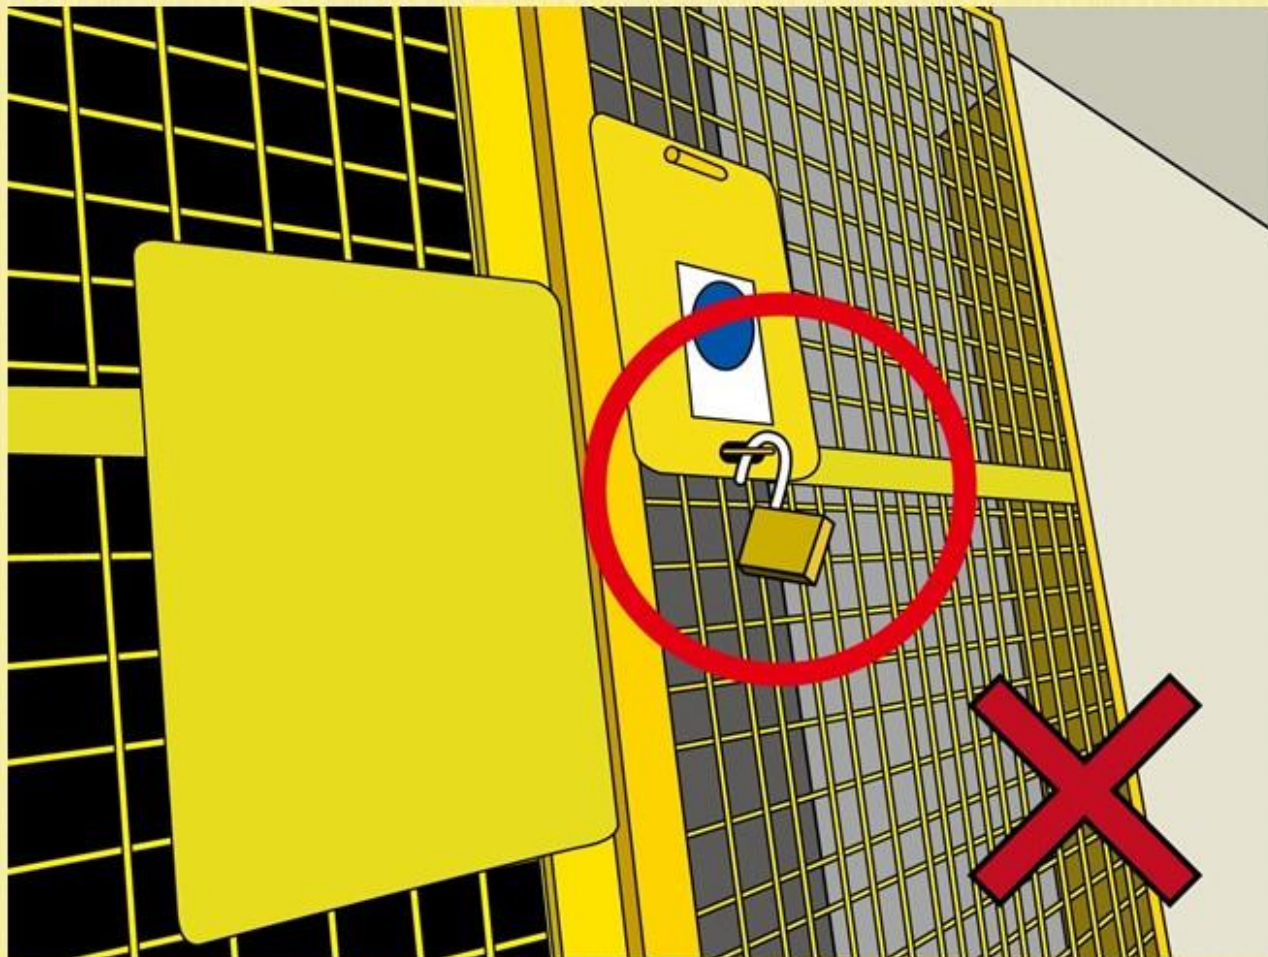


工友未有佩戴安全帶

WORKER DID NOT USE FALL ARRESTING
SYSTEM

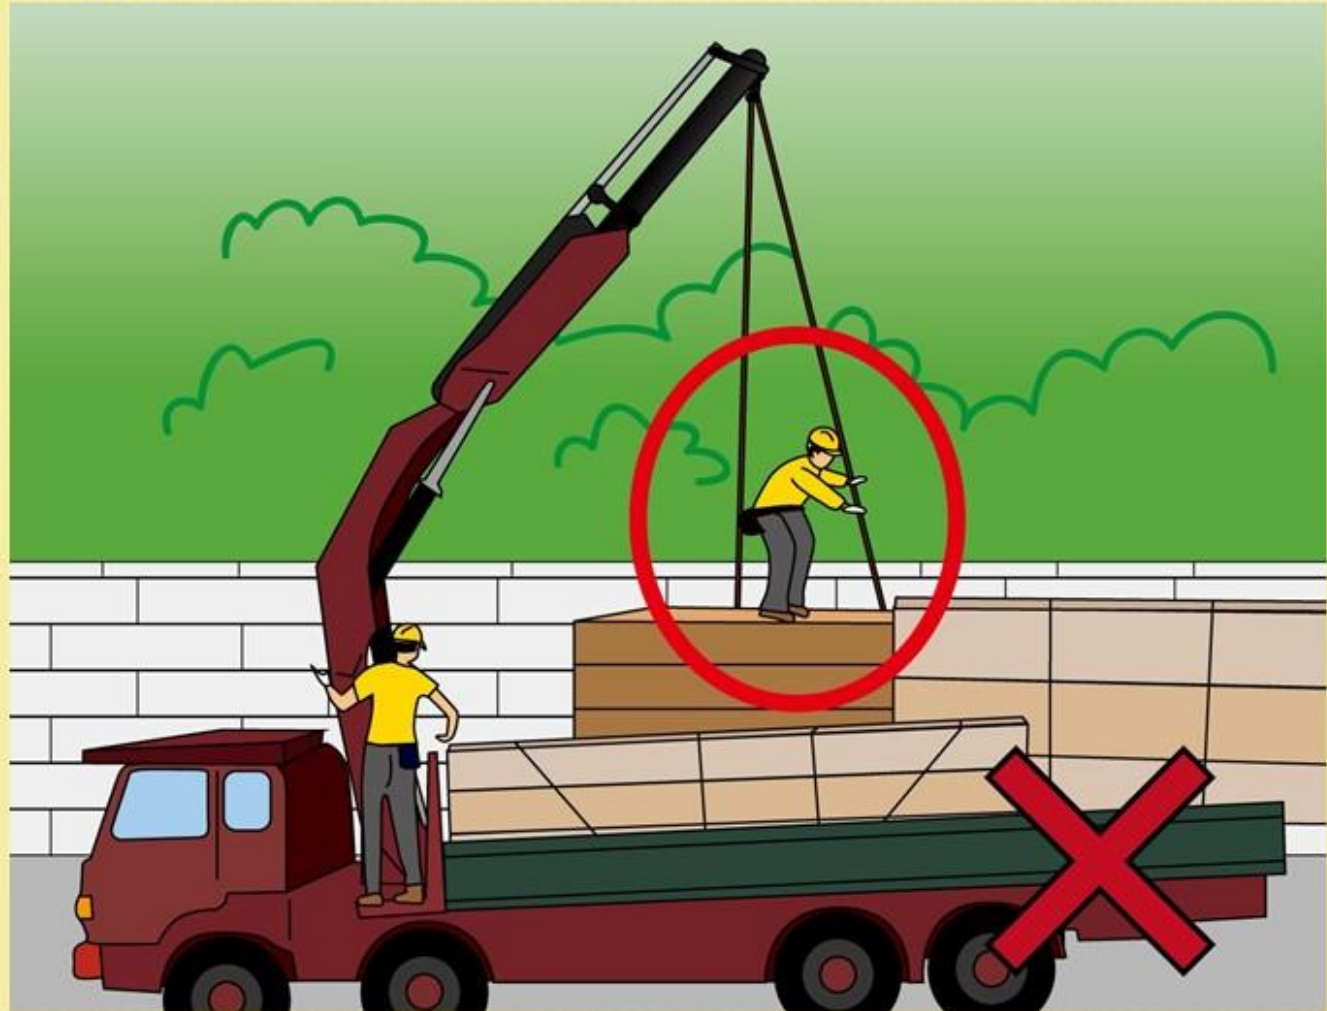


地洞蓋沒有被穩固

COVER OF FLOOR OPENING WAS NOT SECURELY
FIXED IN POSITION

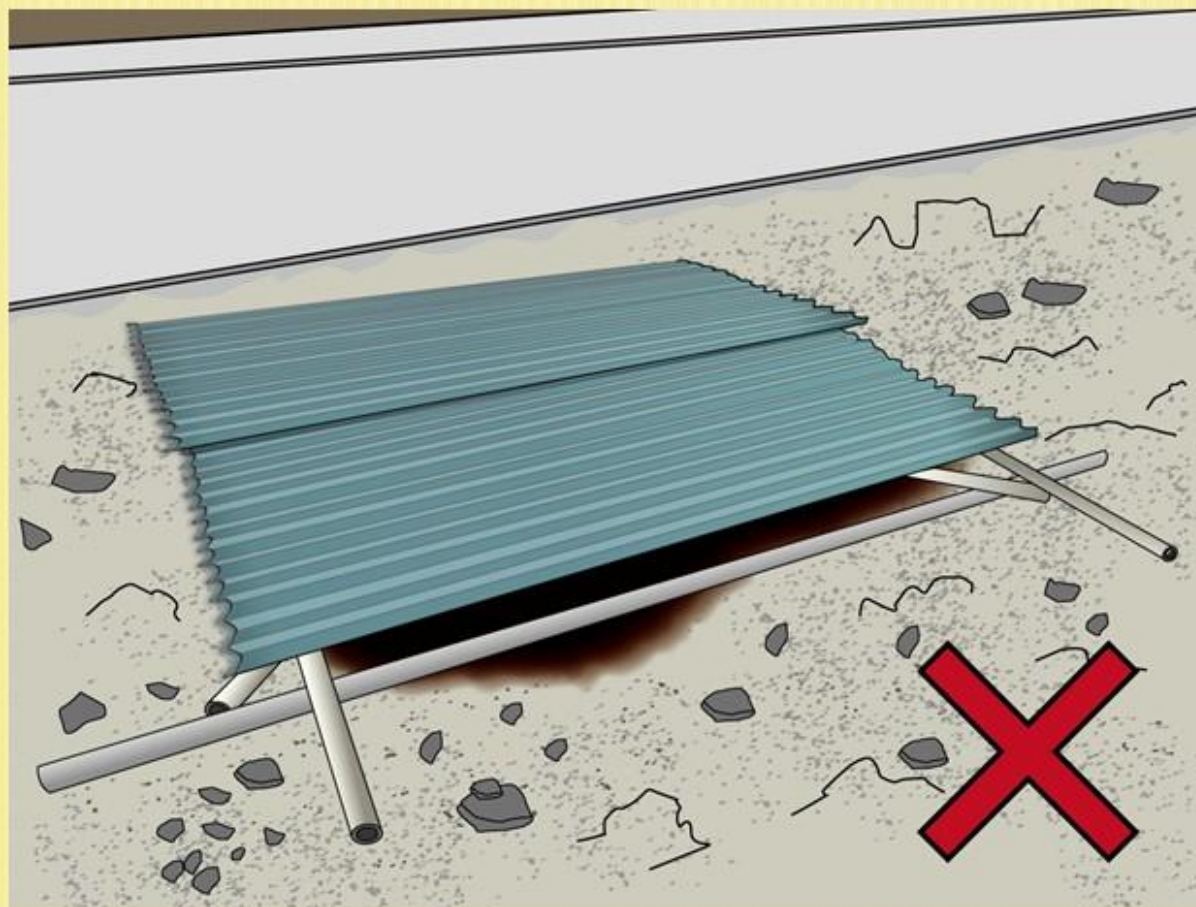


安全帶沒有連接於繫穩點

WORKER'S SAFETY HARNESS WAS NOT
CONNECTED TO ANCHORAGE POINT

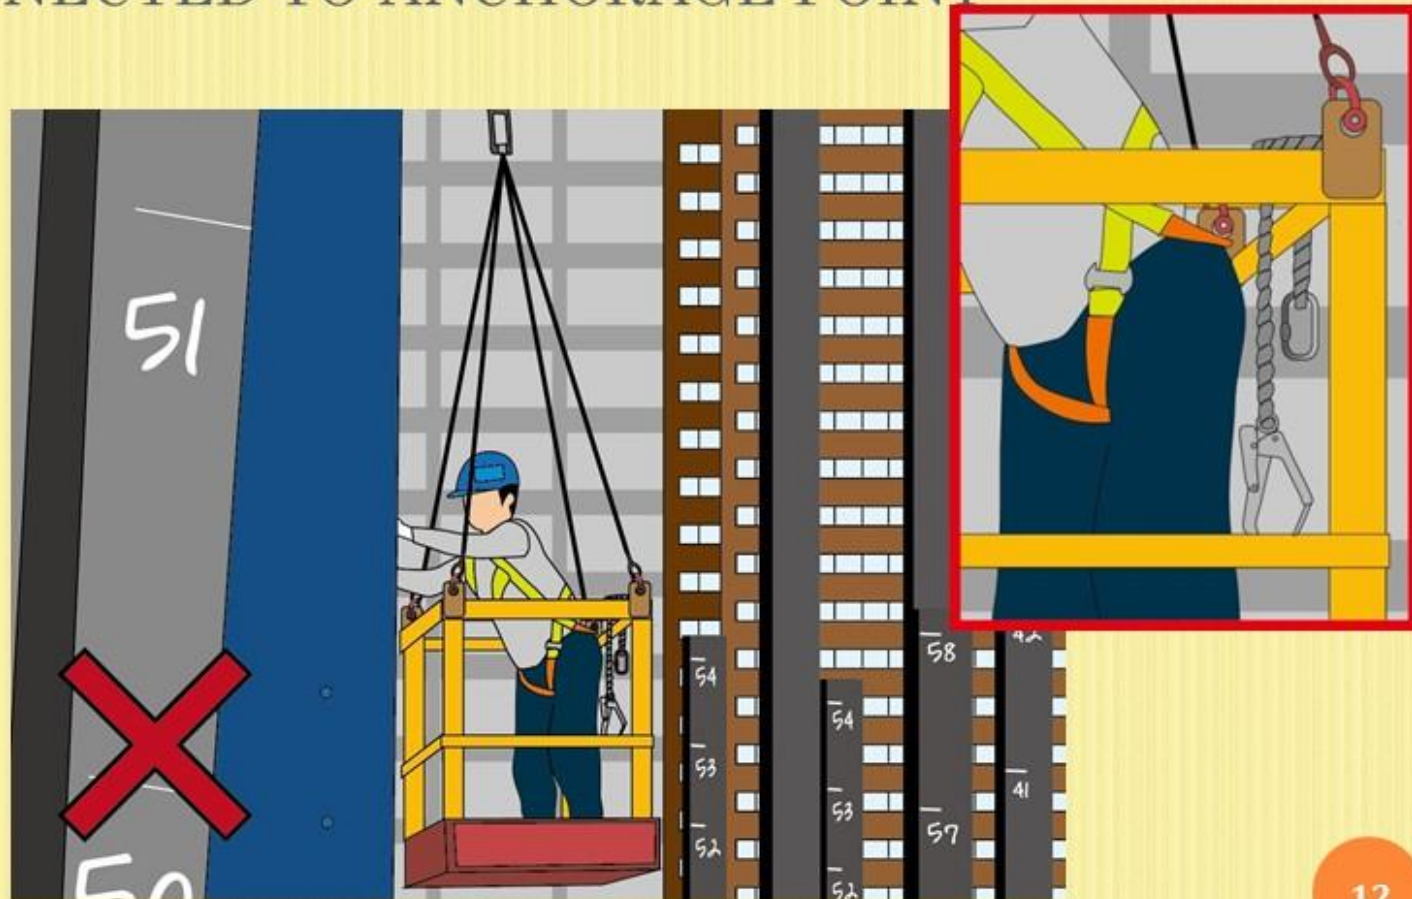

有眼螺栓的方向應與拉力方面一致

THE EYEBOLT SHOULD BE ORIENTED IN LINE WITH THE INTENDED LINE OF FORCE OF THE INDEPENDENT LIFELINE

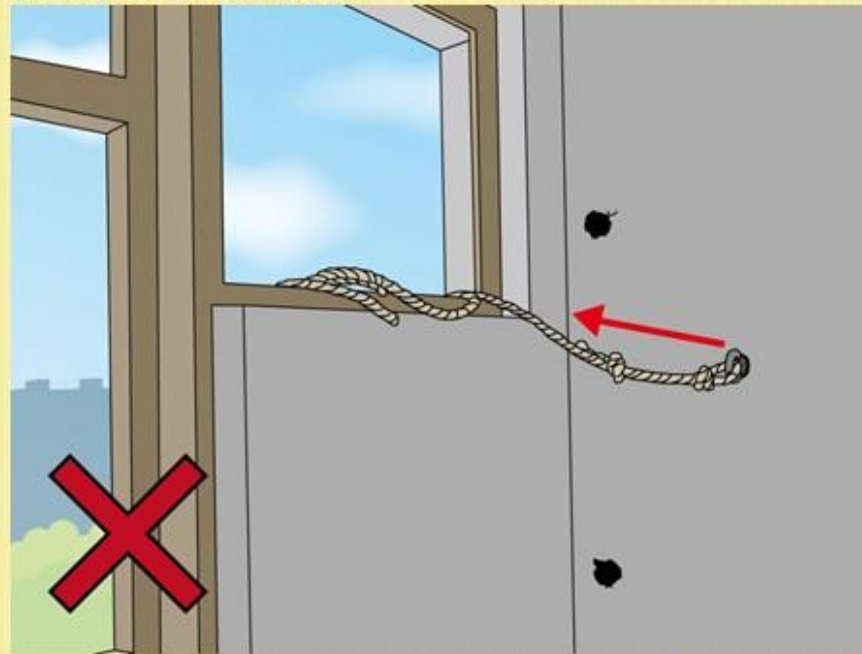


如果側身負載，吊環螺栓可能會彎曲。麻袋應放在周圍鋒利的邊緣/角以保護救生繩。If the load is applied sideways, the eyebolt may bend. Sacking should be placed around sharp edge/corner to protect the lifeline.

竹棚架沒有安裝足夠的連牆器

THE PUTLOGS INSTALLED ON THE BAMBOO SCAFFOLD WERE INSUFFICIENT


- 縱行每4米或以下，
橫行每7米或以下
- **Every 4m or less rise and
7m or less apart
horizontally**

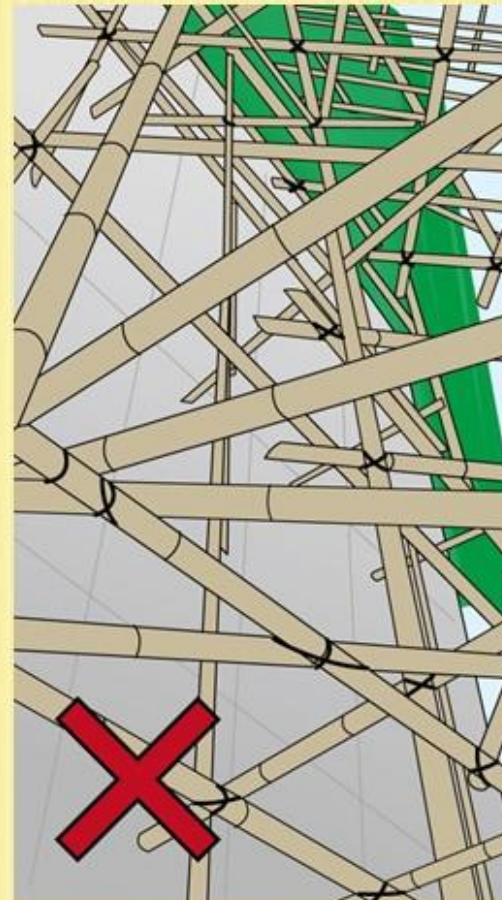

兩條連接之竹竿的重疊長度不足

LENGTH OF OVERLAP WAS INSUFFICIENT FOR CONNECTING 2 BAMBOO MEMBERS


- 兩條連接之竹竿的重疊長度:
 - 對於直杆，應為1.5米至2米。
 - 對於大橫杆及斜杆/斜撐，應不小於2米

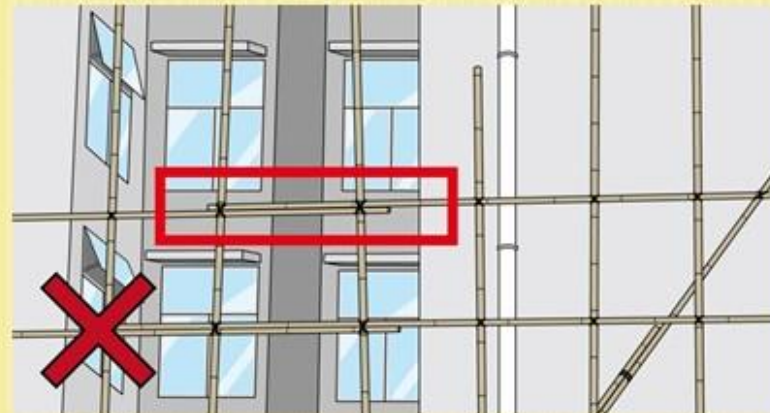


- **For connection between 2 bamboo members, the length of overlap should be:**
 - **1.5m to 2m for standards**
 - **at least 2m for ledgers and bracings /rakers**

沒有符合要求的雙行護欄及踢腳板

NO PROPER GUARD-RAILS AND TOE-BOARDS

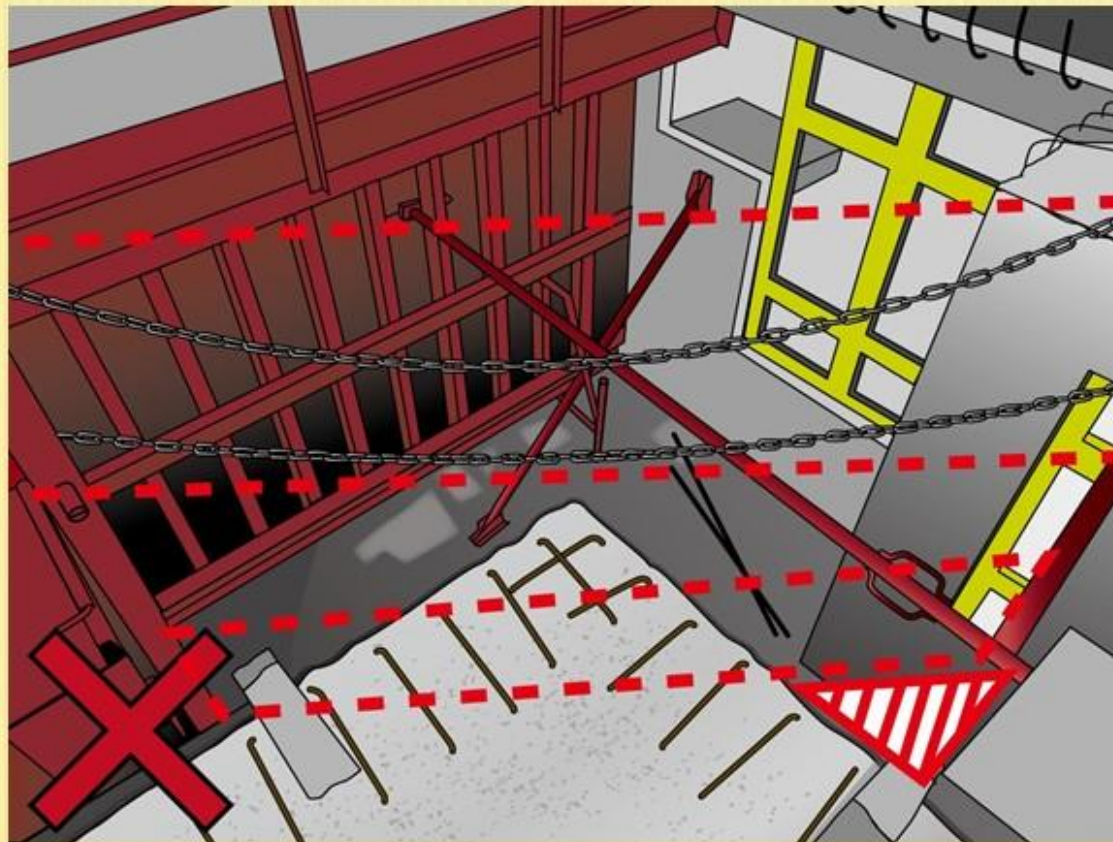

沒有在升降機槽開口位置加設完全圍封閘門
NO FULL HEIGHT METAL GATES AT LIFT SHAFT
OPENING

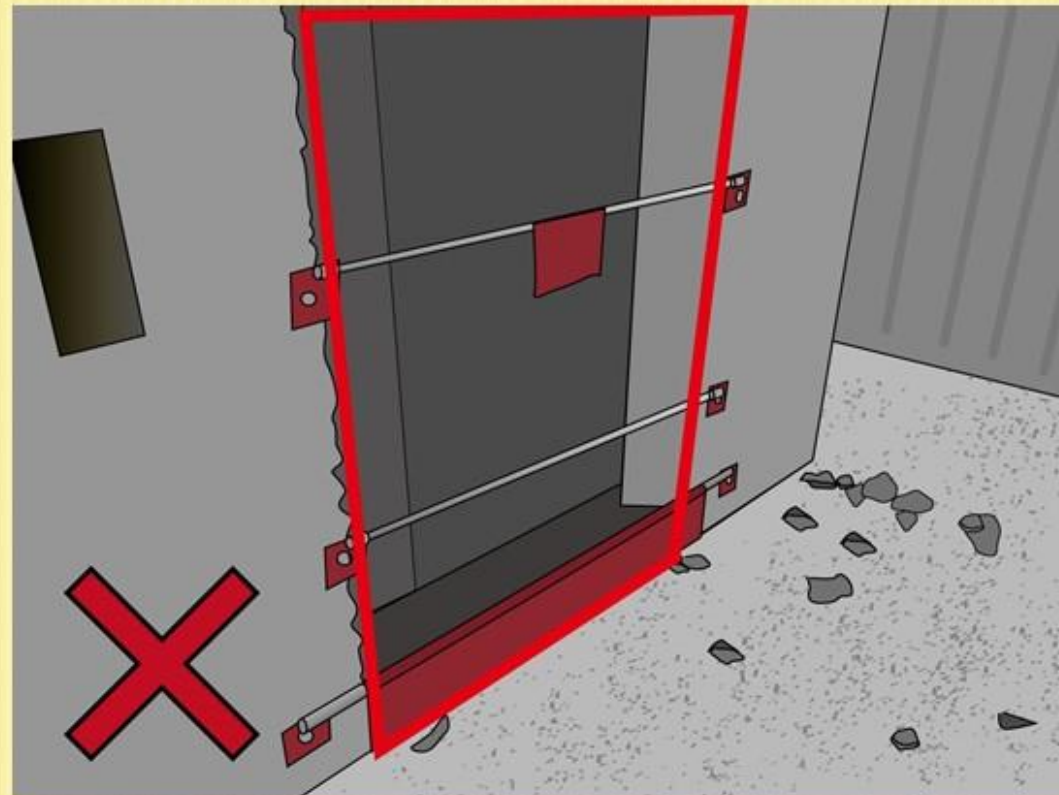

使用梯子在離地兩米以上地方工作

LADDER USED FOR WORKING AT 2 METRES OR ABOVE



使用中的流動工作台無有效的表格五。沒有安裝腳架以穩固工作台。

MOBILEWORKING PLATFORM IN USE HAD NO VALID FORM 5. OUTRIGGERS WERE NOT INSTALLED TO STABILIZE THE WORKING PLATFORM.



不適當地配戴安全帶。配戴腿帶的方法不正確。

IMPROPER WEARING OF SAFETY HARNESS ON GONDOLA. THE LEG STRAPS WERE NOT CORRECTLY WORN.



高空工作台及天面間沒有進出設備；不安全的木板路。

ACCESS EQUIPMENT WAS MISSING BETWEEN ACCESS TOWER AND THE WORKING FLOOR.
UNSAFE GANGWAY WAS PROVIDED FOR THE SITE.



低於2米的工作台處於不安全操作狀態。

WORKING PLATFORM BELOW 2M WAS NOT IN GOOD WORKING ORDER.

